


21605040000

U. S. PUBLIC LAND SURVEY MONUMENT RECORD

SECTION 9 T 16 N, R 5 W, TOWN OF Bangor

LA CROSSE COUNTY

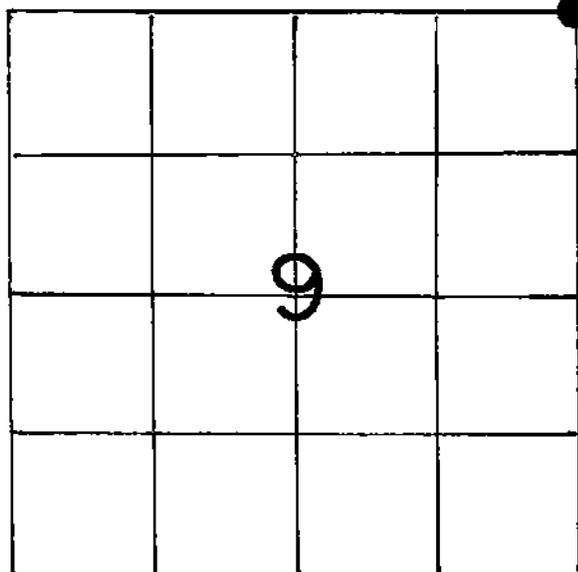

LOCATION OF LANDMARK

Crew: William C. Jung
Peter Follansbee

Date: 10/27/88

Describe any record evidence, monument evidence, testimonial evidence or any other material evidence you considered and whether the monument was found or restored through acceptance of an obliterated evidence location. *wey*

I set the corner at a computed location that best fits the overall field evidence. (3) local residents told me that their fathers told of a stone at this corner. With a backhoe we dug a large hole and with probing covered an area of 9'x10'x4' deep. No stone was found. We patched the road and set the railroad spike at the computed corner. I do not doubt that there was at one time a stone at the corner. When "B" was rebuilt, the stone was probably ripped out like the stone was at the North 1/4 corner of Section 3.

Describe or show any material discrepancy between the location of the restored corner and that of the corner previously restored or reestablished.

None known.

**** The Lunde marker was destroyed during road construction. I set a 1"x30" iron pipe at the corner.

7/24/93 Jung and Follansbee

**** We found the iron pipe chipped out in the pavement.

9/6/96 Jung and Follansbee

WISCONSIN COORDINATE SYSTEM

North

East

Theta Angle

Horiz. Order

Vert. Order

TYPE OF LANDMARK ****iron pipe

~~Railroad Spike~~ ** (Lunde)


BEARINGS ARE REFERENCED TO

True

** Replaced the railroad spike with a brass capped Lunde marker on 8/1/89. Buried a bottle with a blank bullet to the South of the Lunde. (Jung & Follansbee)

RECORD OF DURABLE WITNESS MONUMENTS


NO	DESCRIPTION	BEARING	DISTANCE
1	Set a 1 1/4" iron pipe, flush, W. side of dwy.	North ±	28.00
2	P.K. nail in utility pole	-----	143.42 443.22
3	To the center of a utility box	-----	46.55 46.60
4	P.K. nail in utility pole	-----	204.87 204.90

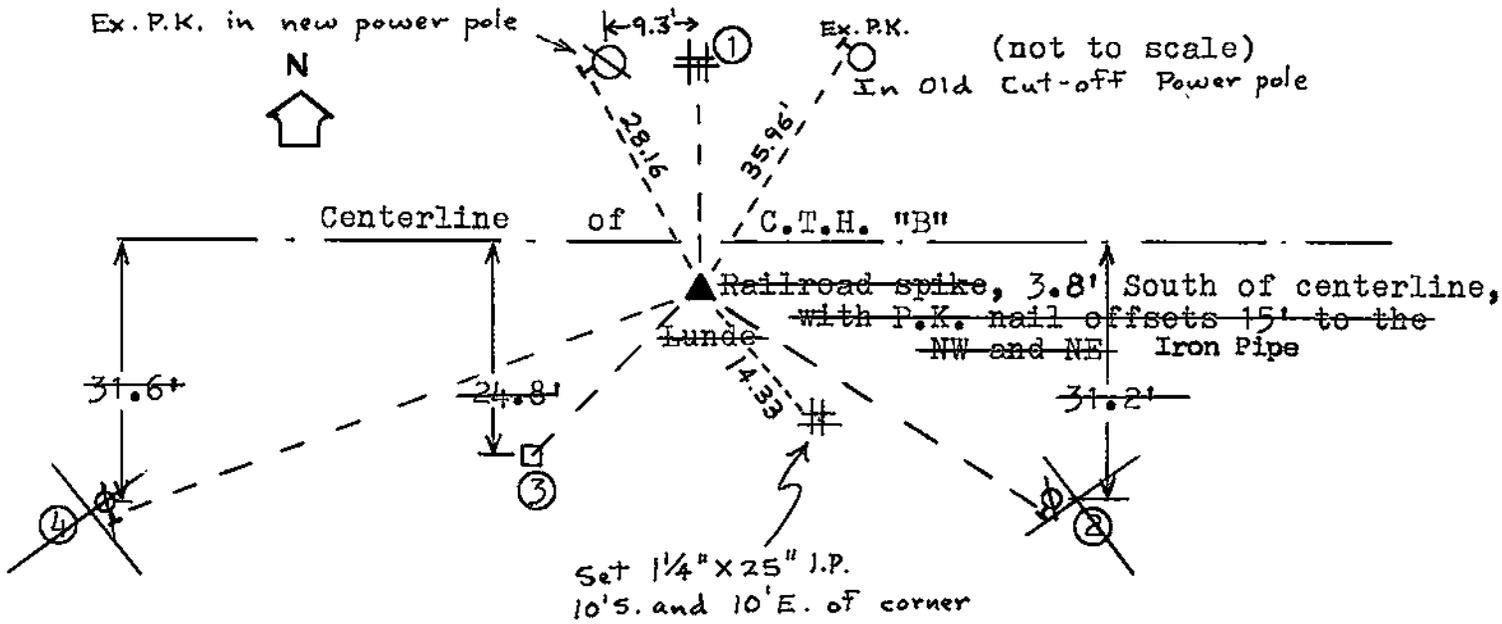

PLAN VIEW DRAWING OF REFERENCE TIES

MAP SHOWING DISTANCE AND DIRECTION TO OTHER PUBLIC LAND SURVEY CORNERS USED FOR REESTABLISHING THE CORNER

(not to scale)

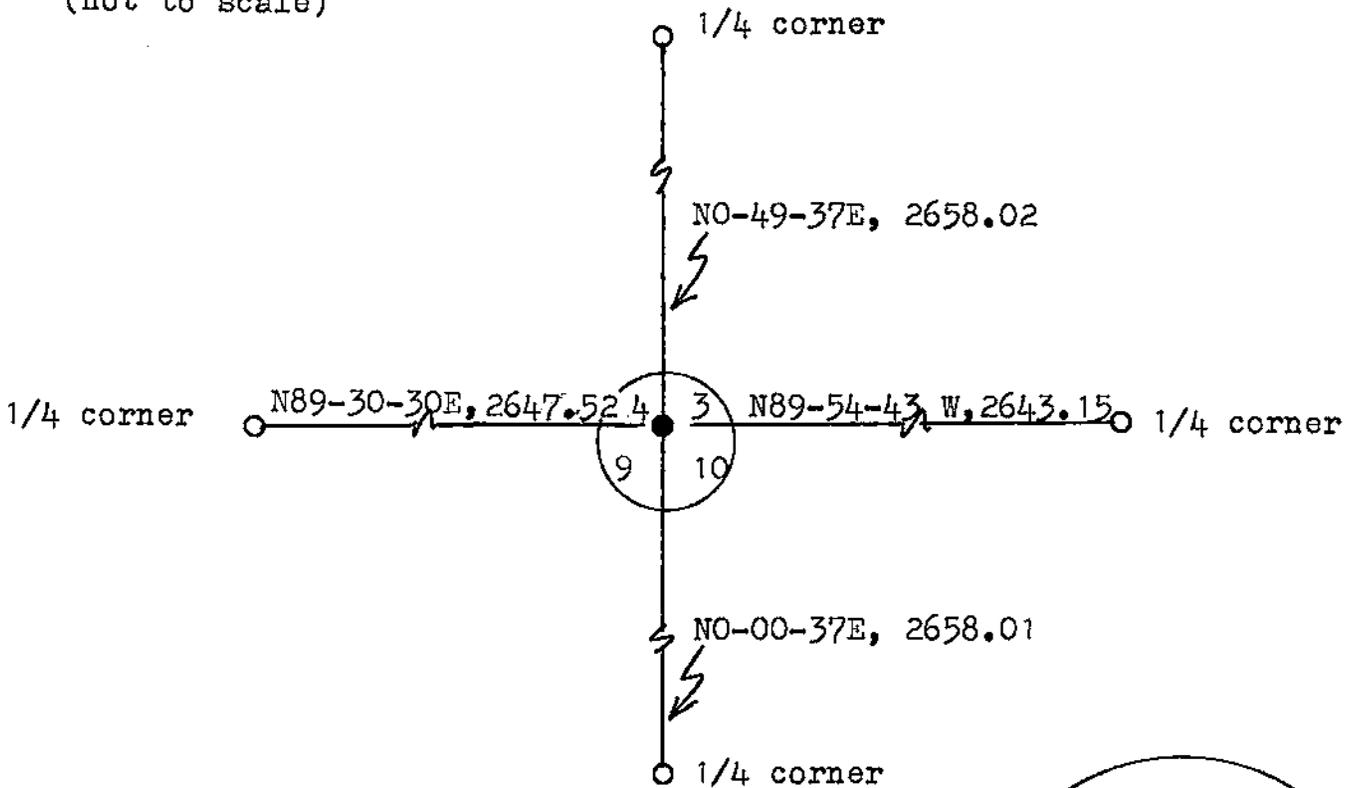


I, William C. Jung, Deputy County Surveyor,
 HEREBY CERTIFY THAT THE CORNER LOCATION SHOWN ON THIS RECORD
 WAS DETERMINED BY ME OR UNDER MY DIRECTION AND CONTROL AND
 THAT THIS U. S. PUBLIC LAND SURVEY MONUMENT RECORD IS CORRECT
 AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF.

William C. Jung
 Signature

1/12/89
 Date

Revised: 12/3/96 *wcj*

Revised: 1/8/90
 Revised: 1/18/94 *wcj wcj*

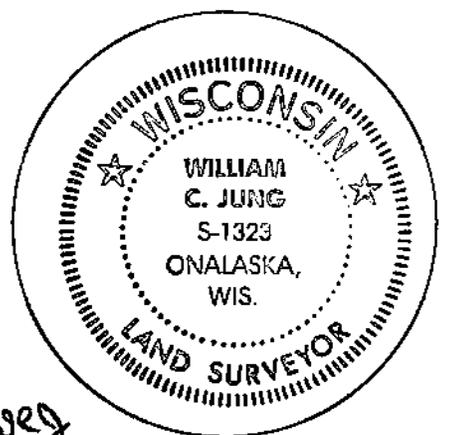

Seal